OREGON CORNER RESTORATION FORM


Section County	10 Morrow	_Township Date:	1SRange April 16, 2019	23E	
Corner De	esignation:	1S23G17			Condition Report Only Not found
1/4 corner common to sections 10 and 11 T1S, R23E,				X	Remonumented
W.M., Morrow County, Oregon.					Unrecorded
	•	-			Surveyed in
				Y	Referenced out

Previous Renewals / Surveys, etc.

Corner was originally set by David P. Thompson under contract No. 109 Dated January 30, 1865. His record reads: Set post for 1/4 section corner in mound of earth with charred stake, pits & c. as per instructions.

Monument and Accessories found: (condition and source)

Found a corner in the field lines with plow lines running north and west with remains of fences.

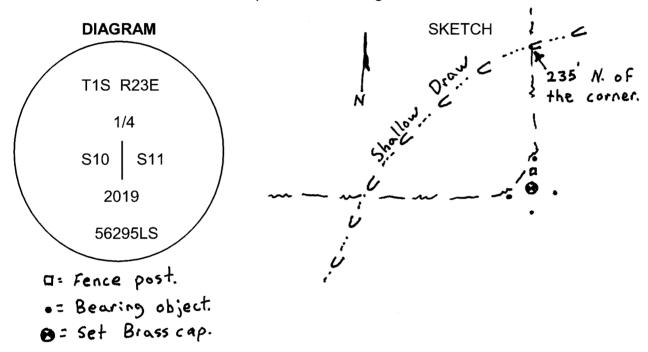

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the corner point I set a 2 3/8" brass cap on a 1 1/2"x30" galvanized iron pipe 30 inches in the ground. The cap was stamped as shown in the diagram above. I set a fence post 12" diameter by 8 feet long 3 feet in the ground on the north side of the cap with a Morrow County monument sign attached.

For references, I set four 5/8" by 24" rebars with 1.25" orange plastic caps stamped WTS and 56295LS as described below:

- a rebar bears N1°30'46"W, 24.26 feet, 20 inches below the surface;
- a rebar bears N83°28'32"E, 27.20 feet, 20 inches below the surface;
- a rebar bears S0°20'19"E, 27.27 feet, 20 inches below the surface;
- a rebar bears S84°16'29"W, 26.15 feet, 20 inches below the surface;

Measurements to the cap and references were made with a Trimble RTK GPS system.

Compass Declination Surveyors Seal Location and comments Witnessed by: REGISTERED Firm / Agency **PROFESSIONAL** Witness Tree Surveying RECEIVED BY: LAND SURVEYOR Morrow County Surveyor Address Date: 5-27-2019 P.O. Box G take L. Hallo Pilot Rock, Or. 97868 Rec'd By: S.K.H. OFEGON 1523 G17 Party Chief No. JULY 9, 2001 Stephen K. Haddock Survey No. STEPHEN K. HADDOCK 56295LS RENEWS: 6-30-21