DIAGRAM

	T6S	R25E
	¼S5	
T7S		R25E

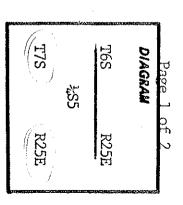**History of original corner establishment:**

This corner was established in 1879 by A. York under G.L.O. contract No. 309. He set a stone 13"x9"x5" from which:

A Quaking Ash, 5" dia., bears N50°E, 56 links
A Fir, 8" dia., bears S55°W, 60 links
(See Page 2 of 2 for retracement history)

Description of corner evidence found:

I found an old, 11" dia. Aspen stump with evidence of a blaze on the westerly side at about the 4" dia. I opened the stump and found it badly rotted with no scribing visible. York appears to have blazed high and this stump is low cut. This stump is in a small and isolated Aspen swamp. There are not Cottonwoods in the area. I found no evidence of the corner stone or of the Fir B.T. The facing of the blaze best fits Sanderson's bearing. From the corner point:

Aspen stump, 11" dia., bears N80°E, 29.0 ft.

Description of monument and accessories I established to perpetuate the original location of this corner:

I set a 2½"x30" alum. pipe with a 3" alum. cap containing a magnet and marked:

From which:
New B.T.'s
Tamarack, 10" dia., bears S38 3/4°W, 71.4 ft.
White Fir, 11" dia., bears S21 3/4°E, 52.7 ft.

The original B.T. stump has an "attention" sign and a B.T. tag. The new B.T.'s have, additionally, a 6" red enamel stripe and an alum. "PLS 1832" washer and are scribed according to the manual.

There is a 6' steel fence post with an "attention" sign within 5' of the corner.

REGISTERED
PROFESSIONAL
LAND SURVEYOR
OREGON
JULY 13, 1979
FAYETTE S. MUNRO
1832

Fayette S. Munro

Office of ....Surveyor........ County of ....Marrow....
State of ....Oregon.... I hereby certify that the within instrument was filed in this office
for record on the ..2.. day of ....July........ 19 84
....Daniel H. Klim.... by ....
(COUNTY OFFICIAL)   (DEPUTY)

RECEIVED BY
Marrow County Surveyor
Date 10/24/84
Received by MLD
No. 700

PLS 1832
T6S   R25E
¼S5
T7S   R25E
1984