

OREGON CORNER RESTORATION FORM

Section 27 Township 4S Range 28E
 County Morrow Date: October 17, 2018

Corner Designation: 4S28T13 x Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out

1/4 corner common to sections 27 and 28 T4S, R28E,
 W.M., Morrow County, Oregon.


Previous Renewals / Surveys, etc.

The corner was originally established by Zenas Moody under contract No. 184 dated March 29, 1873. His record reads: Set post in earth mound for 1/4S Cor. In survey D-204-K Donald Staebler set a 2" pipe and found a 24" tamarack BT N85°E, 85 links and a 24" Tamarack BT North, 55 links. In survey D-802-K-652 Douglas Ferguson found the 2" iron pipe by Staebler and set a 2 1/2" x 30" aluminum pipe with 2 1/2" aluminum cap in place of the pipe. He also found a 20" dbh fir N5°W 36.8' scribed 1/4BT; a 30" dbh fir N60°W 38.4' scribed 1/4 BT; and set new BT's - a fir 8" dbh bears N82°W 9.4' scribed 1/4 S28 BT and a fir, 7" dbh bears S37°E 14.5' scribed 1/4 S27 BT.

Monument and Accessories found: (condition and source)

I found the aluminum cap set by Ferguson as described and stamped as shown in the diagram below. I found a 33" dbh fir, N60°W with healed blaze and signs attached; a 25" dbh fir, N5°W with an open blaze, scribes visible and signs attached; A 6" fir, dead and down, with BT sign and a brass washer, open blaze with scribes visible approximately S37°E, the true location of the tree was indeterminate; An 8" fir, dead and down, with BT sign, open double blaze with scribes visible approximately N82°W, the true location of the tree was indeterminate; A 24" tamarack snag with open partially healed blaze scribed BT bears N85°E, 55.4' from Al. cap to the face of the blaze; at a point North 36.3' I find the charcoal remains of what may have been the second tamarack found by Staebler.

DIAGRAM

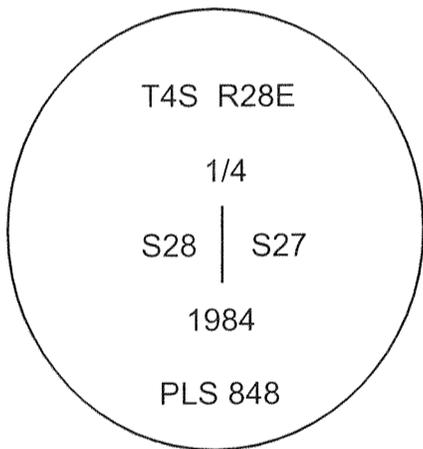

SKETCH

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the request of the landowner I fell the tamarack snag which will constitute a danger tree for a proposed dwelling. I cut the snag above the open blaze leaving a stump approximately 5.5 feet tall. I tapered the top of the stump and removed the bark to slow the process of the stump rotting out. I attached a Morrow County bearing object sign to the stump below the open blaze.

Location and comments

Witnessed by:
 Mr. Thomas Wood of
 Hermiston Oregon.

Compass Declination

Firm / Agency
 Morrow County Surveyor
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K. Haddock

Surveyors Seal

RECEIVED BY:
Morrow County Surveyor
 Date: 10-17-2018
 Rec'd By: S.K.H.
 No. 45 28 T13
 Survey No. _____

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Stephen K. Haddock

OREGON
 JULY 9, 2001
 STEPHEN K. HADDOCK
 56295LS

RENEWS: 6-30-19