

# OREGON CORNER RESTORATION REPORT

CORNER DESIGNATION: T1N, R26E, T-17

1/4 CORNER TO SECTIONS 26 & 27, TOWNSHIP 1 NORTH, RANGE 26 EAST, W.M., MORROW COUNTY, OREGON.

## PREVIOUS RENEWALS / SURVEYS, ETC.:

T1N, R26E WAS ORIGINALLY SUBDIVIDED BY HAFT UNDER CONTRACT NO. 99, DATED JULY 8, 1861 IN WHICH THE NOTES READ, "DEPOSITED A PINT OF CHARCOAL SET A POST FOR QR. SEC. CORNER & RAISED A MOUND WITH TRENCH AND PITS AS PER INSTRUCTIONS".

## MONUMENT AND ACCESSORIES FOUND:

NO EVIDENCE OF THE HAFT CORNER REMAINS, FALLS IN THE INTERSECTION OF SAND HOLLOW ROAD AND BEACH LN. HELD THE THE CENTERLINE INTERSECTION OF ROADS RUNNING NORTH-SOUTH, AND WEST. ROAD NOTES (#181 AND #55) CALL TO FOLLOW SECTION LINES AND CORNERS IN THIS LOCATION; THEREFORE, THE ROAD INTERSECTION WAS HELD AS BEST AVAILABLE EVIDENCE.

## MONUMENT AND ACCESSORIES SET:

SET MAGNAIL WITH STEEL WASHER MARKED, "KENNY LS89374" IN ASPHALT. ESTABLISHED 4 REFERENCE MONUMENTS AS FURTHER DESCRIBED AND DETAILED BELOW.

## REFERENCES:

- (A) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS S 47°59'23" E, 51.27'.
- (B) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS N 32°29'26" E, 50.93'.
- (C) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS N 69°20'58" W, 34.18'.
- (D) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS S 50°06'10" W, 44.09'.

## LOCATION / COMMENTS:

CORNER IS LOCATED AT THE INTERSECTION OF SAND HOLLOW RD. AND BEACH LN.


## BEARING BASE:

REPORTED BEARINGS ARE BASED ON PARTITION PLAT NO. 2025-03.


## FIRM:

KENNY LAND SURVEYING  
P.O. BOX 447 HEPPNER,  
OR 97836

## DIAGRAM:

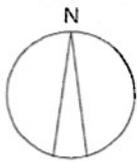

N.T.S.

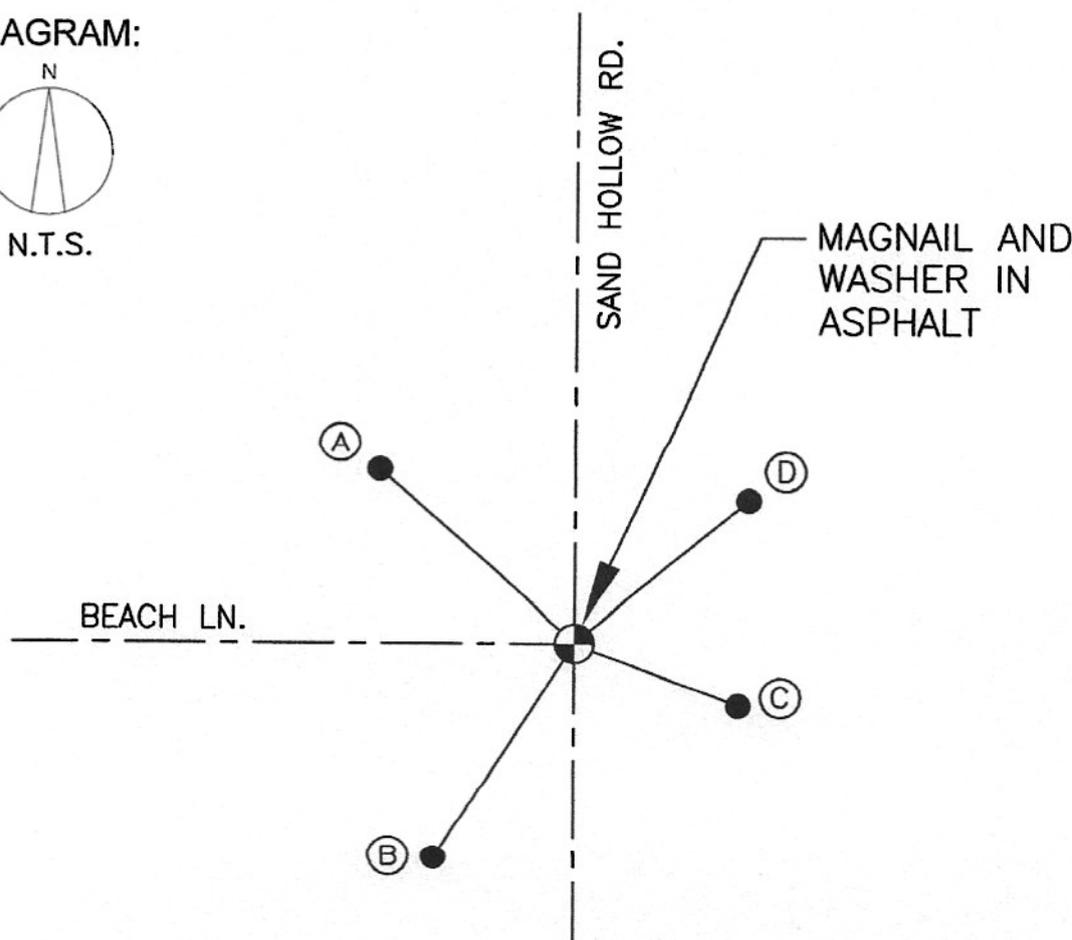

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
JAN 12, 2016  
MATTHEW PATRICK KENNY  
89374PLS

RENEWS: 6-30-25

IN 26 T 17 2093