

OREGON CORNER RESTORATION REPORT

CORNER DESIGNATION: T1N, R26E, Z-15

SOUTH 1/4 CORNER OF SECTION 34, TOWNSHIP 1 NORTH, RANGE 26 EAST, W.M., MORROW COUNTY, OREGON.

PREVIOUS RENEWALS / SURVEYS, ETC.:

THE BASELINE WAS ORIGINALLY SURVEYED BY THOMPSON IN 1859 AND WAS RESURVEYED BY HAFT UNDER CONTRACT NO. 99, DATED JULY 8, 1861 IN WHICH THE NOTES READ, "DEPOSITED A PINT OF CHARCOAL SET POST FOR QR. SEC. CORNER & RAISED A MOUND WITH TRENCH AND PITS AS PER INSTRUCTIONS".

MONUMENT AND ACCESSORIES FOUND:

NO EVIDENCE OF THE HAFT CORNER FOUND. HELD THE LOCATION OF AN OLD FENCE CORNER WITH FENCES RUNNING NORTH AND WEST AS LOCAL CONTROL AND THE BEST AVAILABLE EVIDENCE OF THE CORNER LOCATION.

MONUMENT AND ACCESSORIES SET:

SET 2-1/2" BRASS CAP ON 1" I.D. X 30" GALVANIZED IRON PIPE WITH FLARED BOTTOM, MARKED AS SHOWN IN DETAIL BELOW. MONUMENT IS ON THE SOUTH SIDE OF THE OLD FENCE POST CORNER. ESTABLISHED 4 REFERENCE MONUMENTS AS FURTHER DESCRIBED AND DETAILED BELOW.


REFERENCES:

- (A) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS S 41°39'25" E, 44.33'.
- (B) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS N 30°24'02" E, 26.54'.
- (C) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS N 54°53'51" W, 28.57'.
- (D) SET 5/8"X30" STEEL REBAR WITH PINK PLASTIC CAP MARKED "KENNY LS 89374". CORNER BEARS S 45°56'26" W, 36.83'.

LOCATION / COMMENTS:

FROM INTERSECTION OF SAND HOLLOW RD. AND BASELINE LN., TRAVEL WEST DOWN BASELINE LN. FOR 0.5 MILES. CORNER IS LOCATED SOUTH 0.5 MILES.

DIAGRAM:

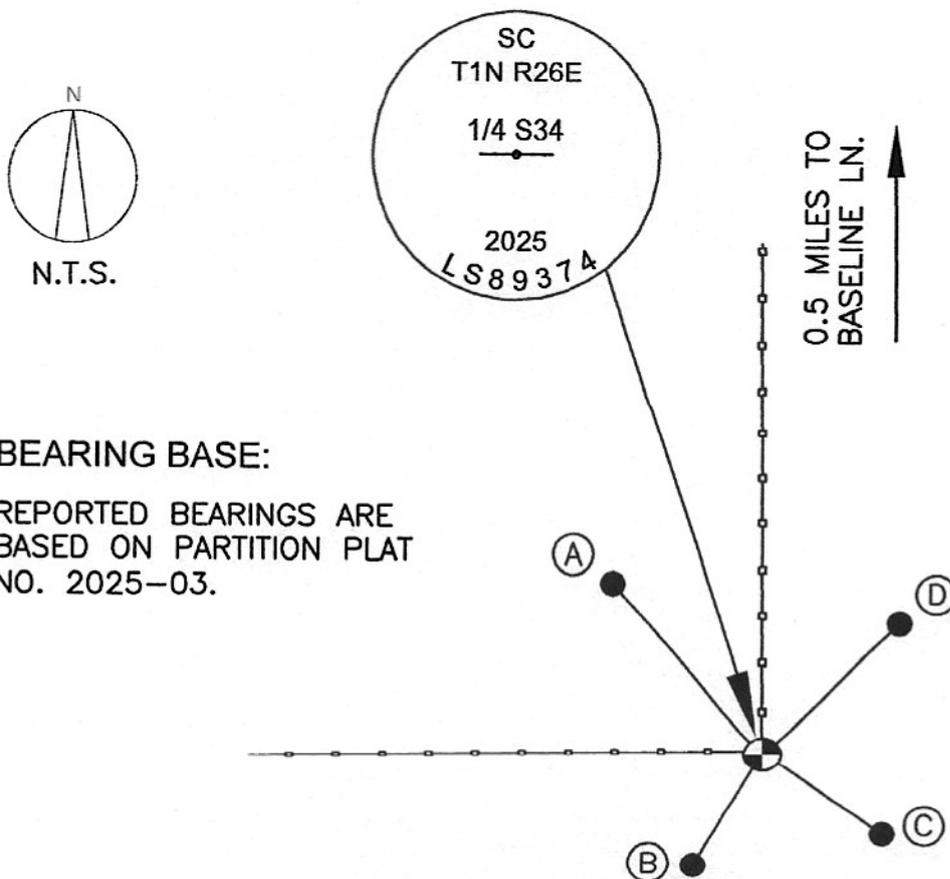

BEARING BASE:

REPORTED BEARINGS ARE BASED ON PARTITION PLAT NO. 2025-03.

FIRM:

KENNY LAND SURVEYING
P.O. BOX 447 HEPPNER,
OR 97836

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JAN 12, 2016
MATTHEW PATRICK KENNY
89374PLS

RENEWS: 6-30-25

IN26Z15 2093