
OREGON CORNER RESTORATION FORM

28 26E Section 26 Township Range County Date: August 17, 2017 Morrow Condition Report Only Corner Designation: 2S26R17 Not found Remonumented Corner to sections 22, 23, 26, and 27, T2S, R26E, Unrecorded W.M., Morrow County, Oregon. Surveyed in Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by B.J. Pengra under contract No. 119 dated February 15, 1867. His record reads: Set stone 14x12x6 as corner to sections 22, 23, 26 & 27. In 1912 D.V.S. Reid set a rock 13x7x5 inches and made four references as follows: NE 12 links - iron 12 inches long with deposit of broken clear glass; SW 12 links 3/4 inch galvanized iron pipe 8 inches long with pint of stone coal; NW 12 links - deposit of broken brown glass; SE 12 links - deposit of broken clear glass; In survey C-97-K Dave Krumbein established a position for this corner by proportion but set no monument. His position has subsequently been used in surveys C-146-K, C-221-K, the Plat of Ployhar Estates and partition Plat 2005-06. In 2008 I set a brass cap at the corner point held by the record surveys above and 4 references as described below under survey 1526C.

Monument and Accessories found: (condition and source)
The brass cap and references reported in 2008 and the NE and SW references by Reid.

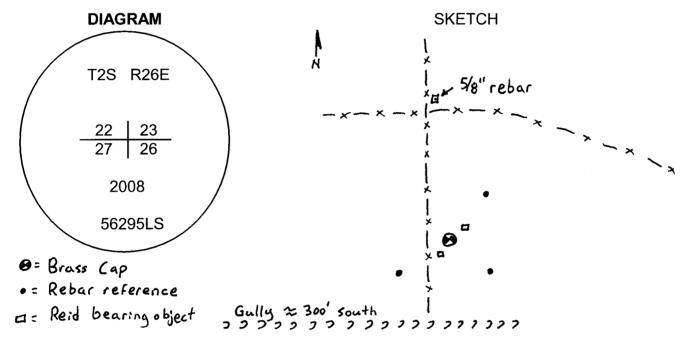

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description) None: This certificate is being recorded to report the finding of Reid's references.

I found the references from 2008 and two of the references set by Reid as follows:

an iron rebar bears N41°30'19"E, 41.64 feet;

an iron rebar bears S48°29'56"E, 31.49 feet;

an iron rebar bears S44°34'19"W, 47.91 feet;

a 5/8" iron rebar of unknown origin bears N02°45'30"W 213.96 feet on the north side of a four way fence intersection.

- a 1" iron pin surrounded by broken clear glass bears N68°12'10"E, 9.64 feet;
- a 3/4" iron pipe and chopped stone coal bears S22°11'37"W, 8.02 feet;

The monument was set and the references were tied using a Trimble R7/R8 RTK GPS.

Surveyors Seal **Compass Declination** Location and comments REGISTERED Firm / Agency **RECEIVED BY: PROFESSIONAL** Witness Tree Surveying Morrow County Surveyor LAND SURVEYOR Date: 9-21-2017 **Address** Stesla K. Hallock Rec'd By: S.K.H. P.O. Box G No. 20 2526 R17 Pilot Rock, Or. 97868 OREGON Survey No. 2017-1806D JULY 9, 2001 STEPHEN K. HADDOCK 56295LS

RENEWS: 6-30-19