## **OREGON CORNER RESTORATION FORM**


| Section<br>County   | 34<br>Morrow | Township<br>_Date: | 2S<br>August 9, 2 | <br>_Range<br>2017 | 26E                     |                                 |
|---|--------------|--------------------|-------------------|--------------------|-------------------------|---------------------------------|
| Corner De   | signation:   | 2S26Z13            | •                 |                    |                         | Condition Report Only Not found |
| Corner common to sections 33 and 34, T2S, and sections 3 and 4, T3S, R26E, W.M., Morrow County, Oregon. |              |                    |                   | X                  | Remonumented Unrecorded |                                 |
| 3 and 4, 1.   | 33, RZOE, VV | .ivi., iviorrow    | County, Ore       | egon.              | X                       | Surveyed in<br>_Referenced out  |

Previous Renewals / Surveys, etc.

The corner was originally set by B.J. Pengra under contract 119 dated February 15, 1867. His record reads: Set corner to sections 3, 4, 33, and 34. Drove charred stake and raised mound. In contract 176 dated July 20, 1872, U.S. Deputy Surveyor George Williams calls for a "stone corner" at this point. In 2002 Judson Coppock reported setting a brass cap for this corner by single proportion for the departure and holding an existing fence for latitude.

Monument and Accessories found: (condition and source)

I found a distinct mound of stone in the existing fence line. I found no trace of any monument set by Judson Coppock.

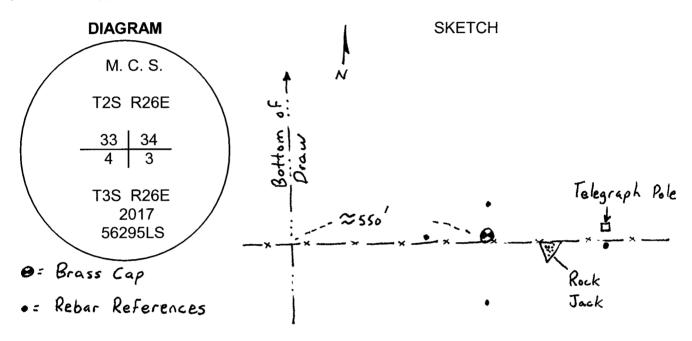

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

In the center of the stone mound I set a 2 3/8" brass cap on a 1 1/2" galvanized iron pipe flush with the surface. This location was confirmed by ties to Stock Drive road to the west and the 1/4 monument by Reid to the east.

For references, I set four 5/8" by 24" rebars with 1.25" orange plastic caps stamped WTS and 56295LS as described below:

an iron rebar bears N04°02'51"E, 54.34 feet;

an iron rebar bears N89°21'23"W, 23.35 feet under the existing fence;

an iron rebar bears S89°37'26"E, 37.17 feet;

an iron rebar bears S00°36'17"W, 68.36 feet;

the unmonumented computed point by Coppock bears N60°34'57"E, 20.71 feet more or less and lies 12 feet, more or less, north of the existing fence line.

Measurements were made with a Trimble RTK GPS.

Location and comments

**RECEIVED BY:** 

Morrow County Surveyor

Date: 9-21-2017

Rec'd By: S.K.H.

No. 2017 2526713

Survey No. 2017 - 1806 D

**Compass Declination** 

Firm / Agency

Morrow County Surveyor

Address

P.O. Box G

Pilot Rock, Or. 97868

Party Chief

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Stephen K. Id affork

OREGON JULY 9, 2001 STEPHEN K. HADDOCK 56295LS

RENEWS: 6-30-19