

OREGON CORNER RESTORATION FORM

SECTION 25|30

TOWNSHIP 4 NORTH

RANGE 25|26 EAST

COUNTY: MORROW

DATE: 03/01/2016

CORNER DESIGNATION: T-1

PREVIOUS RENEWALS / SURVEYS, etc.


THE ORIGINAL CORNER SET BY U.S. DEPUTY SURVEYOR J. DAVID IN 1869. HE SET A POST IN MOUND.

OTIS GOULD CONDUCTED A DEPENDENT RESURVEY COMPLETED IN 1939. AT THAT TIME HE FOUND A ROTTEN STAKE WITH TRACES OF SCRIBE MARKS, AND SET A 2" DIAMETER 3' LONG IRON POST WITH A BRASS CAP AND DEPOSITED THE ORIGINAL STAKE BENEATH, AND DUG PITS.

MONUMENT and ACCESSORIES FOUND: (CONDITION AND SOURCE)

AT THE CORNER POSITION, WE FIND GOULD'S 1939 CORNER WHICH APPEARS UNDISTURBED, THE LOCATION OF WHICH SUBSTANTIALLY AGREES WITH BOTH THE GLO RECORD AND CUNNINGTON'S SURVEY FOR THE US NAVY (C-810-K). N63°24'20"W 8.73' FROM SAID GLO MONUMENT, WE FIND A 2.5" BRASS CAP, STAMPED AS BEING THE SAME CORNER, SET BY McKINNIS (LS 2431) ON HIS SURVEY FOR THE MORROW COUNTY COURT (D-1410-M). WE REJECT THE McKINNIS MONUMENT AND ACCEPT THE GLO MONUMENT AS THE TRUE CORNER.

DIAGRAM:

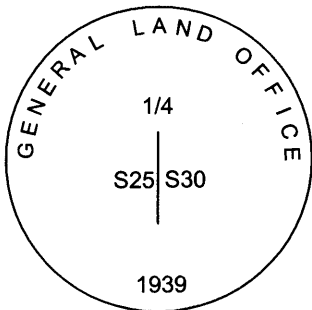

MONUMENT and ACCESSORIES SET (PROCEDURES and DESCRIPTION)

FOUND A 2-1/2" BRASS CAP ON A 1" I.D. 30" LONG FLARED PIPE. MARKED AS SHOWN.

REFERENCES SET:

- From the McKinnis brass cap the corner bears S 63°24'20" E 8.73'
- From a utility pole the corner bears S 42°03' E 4.2'
- From the East Leg of a BPA tower the corner bears S 53° 58' E 195.5'
- From a power pole the corner bears S 2°18' E 77.0'
- From a power pole the corner bears N 0°17' E 246.5'

(Bearings are Grid)
LOCATION and COMMENTS

NAD83 / 2011 Oregon North coordinates (International Feet)
N 778669.32
E 8425775.70

SURVEYORS SEAL

REGISTERED
PROFESSIONAL LAND
SURVEYOR

5-12-16 *[Signature]*

OREGON
NOVEMBER 13, 2012
DAVID P. BAALMAN
86848PLS

RENEWS: 12/31/2017

RECEIVED BY:

MORROW COUNTY SURVEYOR

DATE 5-17-2016

REC'D BY: S.K.H.

NO. 4N26 T1

FIRM / AGENCY

ROGERS SURVEYING, Inc., P.S.
1455 COLUMBIA PARK TRAIL, #201
RICHLAND, WA 99352
(509) 783-4141