OREGON CORNER RESTORATION FORM


Section	11	Township	4S	_Range	28E	
County	Morrow	_ Date:	April 8, 201	16		
•						Condition Report Only
Corner Designation: 4S28E17					Not found	
	9				X	Remonumented
Corner common to sections 2, 3, 10, and 11, T4S, R28E,						Unrecorded
W.M., Morrow County, Oregon.						Surveyed in
,	,	3			х	Referenced out

Previous Renewals / Surveys, etc.

The corner was originally set by F.W. Campbell under contract 507 dated June 28, 1884. His record reads: Set basalt stone 14x10x7 ins. 9 ins. in the ground for cor. to Secs. 2, 3, 10 & 11 marked with 5 notches on S. and 2 notches on E. edges and raised mound of stone along side.

Monument and Accessories found: (condition and source)

The original stone plainly marked as described and firmly set on the west edge of a 3 foot diameter mound of stone.

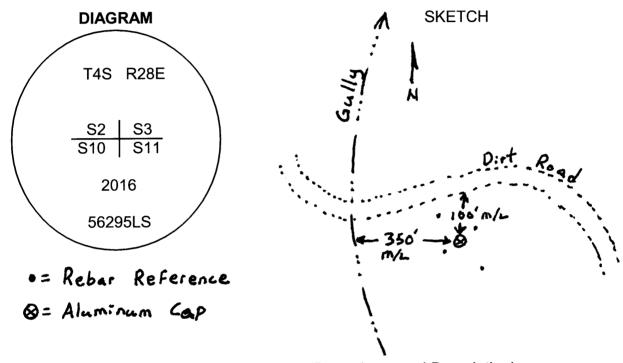

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the position of the original stone I set a 2 1/2"x30" aluminum pipe with a 2 1/2" aluminum cap stamped as shown in the diagram above 22 inches in the ground to bedrock. Raised a 2 foot diameter mound of stone around the cap to the top.

For references, I set four, 5/8" by 24" rebars with 1.25" orange plastic caps stamped WTS and 56295LS as described below:

an iron rebar bears N40°34'31"W, 58.14 feet flush with the surface and with a green cap; an iron rebar bears N60°16'57"E, 21.74 feet flush with the surface;

an iron rebar bears S43°57'15"W, 23.43 feet flush with the surface;

an iron rebar bears S38°55'20"E, 66.15 feet on the north edge of a 2 foot diameter rock;

Measurements were made with a Trimble RTK GPS.

Location and comments Witnessed by: Surveyors Seal Compass Declination REGISTERED **PROFESSIONAL** Firm / Agency RECEIVED BY: LAND SURVEYOR Witness Tree Surveying Morrow County Surveyor The K. Haldon Date: 5-12-2016 Address P.O. Box G Rec'd By: S.K.H. OREGON No. 4528E17 Pilot Rock, Or. 97868 JULY 9, 2001 STEPHEN K. HADDOCK Survey No. 2016-1760 D 56295LS RENEWS: 6-30-17