

# RECORD OF LAND CORNER MONUMENTATION

NORTH 1/4 CORNER SECTION 14, T. 4 S., R. 28 E., W.M.


ORIGINALLY ESTABLISHED BY: Frank W. Campbell, U.S. Deputy Surveyor

CONTRACT NUMBER: 507

CONTRACT DATE: June 28, 1884

**SUBSEQUENT SURVEYS:**

- ▶ Remonumentation performed by Fayette S. Munro, PLS 1832, see corner certificate filed July 21, 1986 in the Morrow County Surveyor's records

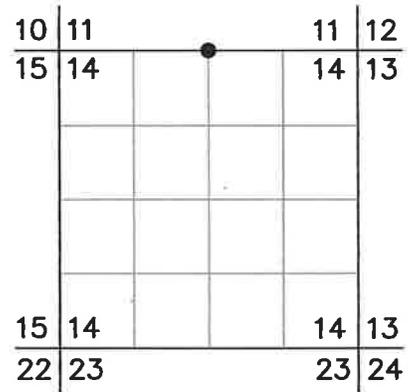

**ORIGINAL DESCRIPTION:** Set a post 3½ ft. long, 3 ins. square, 24 ins. in the ground for 1/4 Sec. Cor. marked 1/4S on N. face, from which

A Fir 16 ins. in diam bears N38°W, 20 lks dist. marked 1/4 S. B.T.

A Fir 14 ins. in diam bears S16°E, 34 lks dist. marked 1/4 S. B.T.

**MUNRO'S DESCRIPTION:** A Douglas fir, 20" dia., S16°E, 22.4 ft. marked: 1/4 S BT on opened blaze

I found no evidence of the second BT or the corner post. These were probably destroyed by construction of a skid trail.

At the original corner point established at record bearing and distance from the original BT I set a 2½"X 30" alum. pipe with a 3" alum. cap containing a magnet and marked: (diagram shown) I built a stone mound around the monument.

From the corner:

A White Fir, 12" dia., S54¼°E, 47.7 ft.; marked: 1/4 S14 BT

A White Fir, 9" dia., N39°E, 37.0 ft.; marked: 1/4 S11 BT

**EVIDENCE FOUND:** Found a 2½" aluminum pipe with 3¼" aluminum cap projecting 8" above ground in a 2 ft. diameter collar of stone.

From which:

- ▶ A white fir snag bears N.39°E., 37.0 ft. (1986 BT)
- ▶ A white fir snag bears S.54°15'E., 47.7 ft. (1986 BT)
- ▶ A Douglas-fir high stump bears S.16°E., 22.4 ft. (1884 BT)


**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

I accept the found aluminum monument for the true corner position.

MONUMENT MARKED:

From which, I SCRIBE THE FOLLOWING NEW BEARING TREES:

- ▶ A grand fir, 7" dbh bears N.49°E., 38.85 ft. marked "S1/4 S11" in upper blaze, and "BT" in lower blaze
- ▶ A grand fir, 15" dbh bears S.25°W., 18.9 ft. marked "N1/4 S14" in upper blaze, and "BT" in lower blaze
- ▶ A western larch, 10" dbh bears N.86°W., 40.9 ft. marked "S1/4 S11" in upper blaze, and "BT" in lower blaze

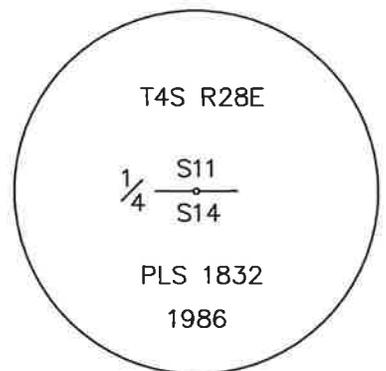

I also SET THE FOLLOWING REFERENCE POINT:

- ▶ A 5/8"x24" iron pin set flush with the ground, bears S.52°E., 32.65 ft., with attached 2½" aluminum cap marked "RM 1 2021 PLS 69454" located 3 feet South of an east-west fenceline.

Painted a 6 inch red band around the bearing trees, and also painted the blazes red. Attached USFS signs 54-3 and 54-9 to the bearing trees. Used a steel tape to measure distances. Distances to BT's measured to a 60d nail set right-side-center at the root crown of each tree. Bearings were measured with a magnetic compass with 14° East declination. Steel T post with USFS signs 54-2 and 54-9 is 4 feet South. Monument is approximately 20 feet North of an east-west fence with a gate.

**RESTORATION BY, STAMP AND DATE:**

Work Performed October 18, 2021 by:

Toribio D. Quinones, LSIT

USDA FOREST SERVICE  
NORTHEAST OREGON LAND ZONE  
1550 Dewey Avenue, Suite A  
Baker City, OR 97814  
(541) 523-1337

**RECEIVED BY**  
**Morrow County Surveyor**  
Date: 1-5-2022  
Rec'd By: MPK  
No.: 4528 J19  
Folder No.:                     

