CERTIFIED RECORD OF LAND CORNER MONUMENTATION

DIAGRAM V-19

History of original corner establishment:

August 30, 1879, under GLO contract No. 325, as follows: The original corner was established by Everett A. Thatcher on

Set a stone, 13" x 9" x 9", for 1/4 section corner, from which:

T5S R25E PLS 1636 1/4 S26 2003 **S35**

A 8" pine bears S40° W, 12 links (7.92 feet) A 10" pine bears N40° E, 42 links (27.72 feet).

Original corner evidence recovered:

Found the original bearing trees as follows: The original corner stone is gone. The area has been badly disturbed by logging activities.

A 24" sawn Ponderosa Pine stump with lower portion of a healed blaze bears S40° W, 7.9 feet. A live and vigorous 27" Ponderosa Pine with healed blaze bears N40° E, 27.7 feet


Monument and accessories established to perpetuate the original position of this corner:

the pipe is marked as shown in the diagram above. 1" x 30" flared, galvanized iron pipe 23" into the ground. A 2 1/2" brass cap attached to the top of from which: At the corner point as determined by reference from the original bearing tree evidence, I set a I build a mound of stones around the pipe

Each of the new bearing trees is scribed on double blazes and has a 3/4" brass washer, marked A 8" Ponderosa Pine, scribed "1/4 S35 BT", bears S66° E, 26.9 feet. A 10" Ponderosa Pine, scribed "1/4 S35 BT", bears S43° W, 41.3 feet. A 8" Ponderosa Pine, scribed "1/4 S26 BT", bears N19° W, 21.5 feet. "PLS 1636", nailed flush to the bottom of the lower blaze. A 8" Ponderosa Pine, scribed "1/4 S26 BT"

Magnetic declination set in compass: 17° E.

NAD '83 UTM Zone 11 position: 4997077N 290082E (plus or minus two meters). I hereby certify the above corner point was perpetuated as hereon described on May 5, 2003

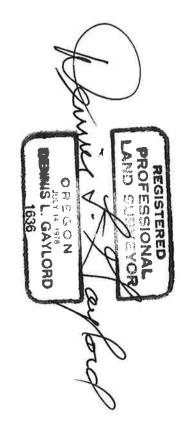

Renews June 30, 2003

Recorded at the office of County Surveyor, County of Morrow, State of Oregon, on:

Morrow County Surveyor RECEIVED BY

Rec'd By: 55 25 VI9 2014

Folder No.: