

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-19

DIAGRAM

T5S R28E
1/4 S23
1/4 S26

History of original corner establishment:

Edward W. Sanderson under G.L.O. contract no. 417, dated Aug. 24, 1881, set a basalt stone 15"x 10"x 6" mkd. 1/4 on N. face from which:
A Fir, 8" dia., S30°E, 18 lks.
A Pine, 8" dia., N25°E, 35 lks.

Leonard Carter, Public Land Surveyor, under G.L.O. Special Instructions, Group No. 228, dated Mar. 23, 1938, found a sandstone 12"x 9"x 6" firmly set, mkd. 1/4 on N. face. At the corner point he set an iron post 3' long, 1" dia. in a mound of stone with a brass cap mkd.:

He marked new BTs:
A Lodgepole Pine, 6" dia., N18 1/2°W, 19 lks. 1/4 S23
A Lodgepole Pine, 5" dia., S28°E, 44 lks. 1/4 S26
1938

Description of corner evidence found:

A 1" dia. iron pipe with a 2 1/2" brass cap (GLO) mkd. as above.
I found no evidence of the 1881 or the 1938 BTs.

Description of monument and accessories | established to perpetuate the original location of this corner:


I marked new BTs:

A Douglas Fir, 5" dia., N20°E, 11.1 ft.; mkd.: X at breast height and BT at base.
A Spruce, 7" dia., N35 3/4°W, 50.1 ft.; mkd.: 1/4 S23 BT
A Douglas Fir, 13" dia., S6 1/2°E, 108.3 ft.; mkd.: 1/4 S26 BT
A Western Larch 9" dia., S43°W, 81.2 ft.; mkd.: 1/4 S26 BT

BTs have blaze and a 6" band painted red, BT tags, "Land Survey Monument" signs and alum. "PLS 1832" washers nailed to the bottom of the blaze. There is a 6' steel fence post with a "Land Survey Monument" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 190E.

July 24, 1990

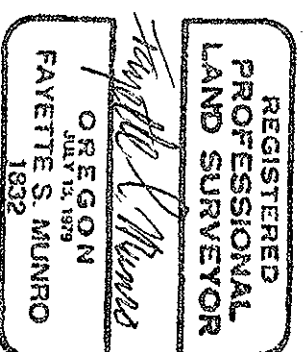

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
by (DEPUTY)
(COUNTY OFFICIAL)

RECEIVED BY
Morrow County Surveyor

Date 11/91
Rec'd By 102
No. C-903 8-19